



the **play inspection** company
the safest hands around playgrounds

Annual Inspection

Carlton Parish Council

Toddlers Play Area

Carlton Diamond Jubilee Orchard, Nailstone Road, Carlton,
Nuneaton, CV13 0BN



Unit 5 Glenmore Business Park, Blackhill Road, Poole, Dorset, BH16 6NL
t - 01202 590675 f - 0870 428 3942 e - info@playinspections.co.uk

www.playinspections.co.uk

Powered by:
**the play ▶
inspection app**
by the play inspection company

Risk Assessment Matrix

Probability>>	5	Very High	VL	L	M	H	VH
	4	High	VL	L	M	H	H
	3	Moderate	VL	L	L	M	M
	2	Low	VL	L	L	L	L
	1	Very Low	VL	VL	VL	VL	VL
		Very Low	Low	Moderate	High	Very High	
		1	2	3	4	5	

Severity>>

Probability Score	Probability of Occurrence
1 – Very Low	No significant probability; lightning Strike
2 – Low	Minimal probability of occurrence. Requires significant factor or combination of factors to take place. Significant increase in intensity of use.
3 – Moderate	Moderate probability. An added factor is needed to cause an accident. Designed use is unlikely to be problematic, additional factor is required. Covers or guards loose, removed or vandalised. Absent guard rail or barrier at high levels
4 – High	High probability. Accident is probable without any added factor. Glass contaminant in loose fill surface. Exposed sharp edges on equipment.
5 – Very High	Very High probability. If the situation is not addressed an accident is almost certain. Severely worn chains/shackles. Severely damaged surfacing within impact area

Severity Score	Severity of injury
1 – Very Low	No injury likely e.g. damaged or soiled clothing, minor bruising
2 – Low	Minor injury – Laceration or bruising requiring first aid only
3 – Moderate	Injury requiring medical intervention e.g. laceration requiring stitches, sprain, fracture of small bones of hand or foot.
4 – High	Serious injury including hospitalisation for observation e.g. concussion, fracture of long bones of leg/arm, back/neck injuries, fractured skull.
5 – Very High	Severe injury involving the potential for permanent disability e.g. amputation, loss of sight, spinal injury, fatality.

NB: When we inspect we only see a snapshot of the current condition of the equipment. It is the operator's responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.

BS EN 1176:2008 Parts 1-11 (Playground equipment and surfacing)
 BS EN 14974 (Facilities for users of roller sports equipment)
 BS EN 15312 (Free access multi-sports equipment)
 BS 10075 (Specification for Parkour Equipment)

Site Information

Inspection Ref: 464132

Site Ref: 35641

Customer Order No: None

Annual Inspection - 25 August 2017 at 08:45 Inspector: John-Aris Hirst (RPII Annual Inspector)

Risk Assessment: **8 - Low Risk**



Location: The site is located in an area of public open space and is overlooked by a number of properties in the local community.

Disabled Access: Some accessible features; an area that presents difficulties to the majority of people with disabilities but in favourable circumstances and certainly in partnership can be accessed.



6 - Low Risk

Item: Ancillary Items - Gate - Maintenance
Manufacturer: Not Identified
Surface Type: Gravel
Equipment Compliance: N/A
Surface Area Compliance: N/A
Ref/Part Number:
Total Findings: 1



Finding 1

There are projecting bolt thread(s) present - Remove excess thread length and deburr or provide cap



4 - Very Low Risk

Item: Ancillary Items - Fencing - Post & Rail
Manufacturer: Not Applicable
Surface Type: Grass
Equipment Compliance: N/A
Surface Area Compliance: N/A
Ref/Part Number:
Total Findings: 1



Finding 1

This item is satisfactory - no work required



4 - Very Low Risk

Item: Ancillary Items - Sign
Manufacturer: Not Identified
Surface Type: Grass
Equipment Compliance: N/A
Surface Area Compliance: N/A
Ref/Part Number:
Total Findings: 1



Finding 1

This item is satisfactory - no work required



4 - Very Low Risk

Item: Ancillary Items - Fence - Timber & Mesh Infill
Manufacturer: Not Identified
Surface Type: N/A
Equipment Compliance: N/A
Surface Area Compliance: N/A
Ref/Part Number:
Total Findings: 1



Finding 1

This item is satisfactory - no work required



3 - Very Low Risk

Item: Ancillary Items - Sign
Manufacturer: Not Applicable
Surface Type: Grass
Equipment Compliance: N/A
Surface Area Compliance: N/A
Ref/Part Number:
Total Findings: 1



Finding 1

This item is satisfactory - no work required



6 - Low Risk

Item: Ancillary Items - Picnic Table
Manufacturer: Not Identified
Surface Type: Concrete
Equipment Compliance: N/A
Surface Area Compliance: N/A
Ref/Part Number:
Total Findings: 1



Finding 1

A number of fixing(s) have worked loose - Secure all loose fixings



6 - Low Risk

Item: Swings - 1 Bay Mixed Seat, 1 Cradle, 1 Flat
Manufacturer: Wicksteed Playgrounds
Surface Type: Bark Mulch
Equipment Compliance: Yes
Surface Area Compliance: Yes
Ref/Part Number:
Total Findings: 1
Life Expectancy: >10 Years



Finding 1

The timber has a number of splits (shakes) although these are not considered to be a problem at present - Monitor to ensure the splits do not cross through fixing points of the structure and cause any instability



8 - Low Risk

Item: Activity Equipment - Multi Play (Junior)
Manufacturer: Wicksteed Playgrounds
Surface Type: Bark Mulch
Equipment Compliance: No
Surface Area Compliance: Yes
Ref/Part Number:
Total Findings: 3
Life Expectancy: >10 Years



Finding 1

The raised timber edge forms a projecting obstacle within the falling space of the equipment which fails to meet the requirements of BS EN 1176 Part 1 - Monitor use


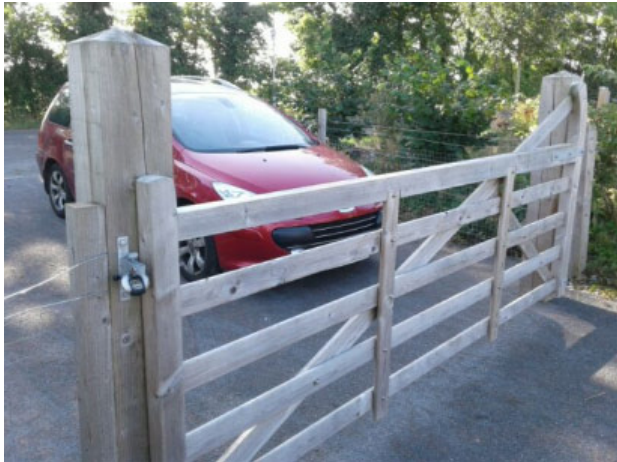

Finding 2




The unit is easily accessible and should have the appropriate barriers installed on the stairs as the height of the unit exceeds 600mm - Monitor use

Finding 3

The timber has a number of splits (shakes) although these are not considered to be a problem at present - Monitor to ensure the splits do not cross through fixing points of the structure and cause any instability

Findings Information

 6 - Low Risk (Finding 1)			
Item:	Ancillary Items - Gate - Maintenance	Risk Level:	L - Low Risk
Manufacturer:	Not Identified	Surface:	Gravel
			
Finding:	There are projecting bolt thread(s) present	Action:	Remove excess thread length and deburr or provide cap

 6 - Low Risk (Finding 1)			
Item:	Ancillary Items - Picnic Table	Risk Level:	L - Low Risk
Manufacturer:	Not Identified	Surface:	Concrete
			
Finding:	A number of fixing(s) have worked loose	Action:	Secure all loose fixings



6 - Low Risk (Finding 1)

Item: Swings - 1 Bay Mixed Seat, 1 Cradle, 1 Flat **Risk Level:** L - Low Risk

Manufacturer: Wicksteed Playgrounds **Surface:** Bark Mulch



Finding: The timber has a number of splits (shakes) although these are not considered to be a problem at present

Action: Monitor to ensure the splits do not cross through fixing points of the structure and cause any instability



8 - Low Risk (Finding 1)

Item: Activity Equipment - Multi Play (Junior) **Risk Level:** L - Low Risk

Manufacturer: Wicksteed Playgrounds **Surface:** Bark Mulch



Finding: The raised timber edge forms a projecting obstacle within the falling space of the equipment which fails to meet the requirements of BS EN 1176 Part 1

Action: Monitor use



8 - Low Risk (Finding 2)

Item: Activity Equipment - Multi Play (Junior) **Risk Level:** L - Low Risk
Manufacturer: Wicksteed Playgrounds **Surface:** Bark Mulch



Finding: The unit is easily accessible and should have the appropriate barriers installed on the stairs as the height of the unit exceeds 600mm
Action: Monitor use



6 - Low Risk (Finding 3)

Item: Activity Equipment - Multi Play (Junior) **Risk Level:** L - Low Risk
Manufacturer: Wicksteed Playgrounds **Surface:** Bark Mulch



Finding: The timber has a number of splits (shakes) although these are not considered to be a problem at present
Action: Monitor to ensure the splits do not cross through fixing points of the structure and cause any instability