


Monitoring of churchyard wall August 2025 to February 2026

This report is an addendum to Report 2025-03, and documents the final monitoring measurements.

In September 2025 it was resolved to prepare a project plan for re-building the churchyard wall, and the project is now underway (p.1989/8; 1994/7; 1999/4 and 2003/5 refer).


The final survey was carried out on 22 February 2026 after a very wet winter. The results are summarised on the chart below: the overhang at screws 7-10 was slightly greater than had ever been measured before while at other points it was almost exactly the same as the greatest deviation found previously.

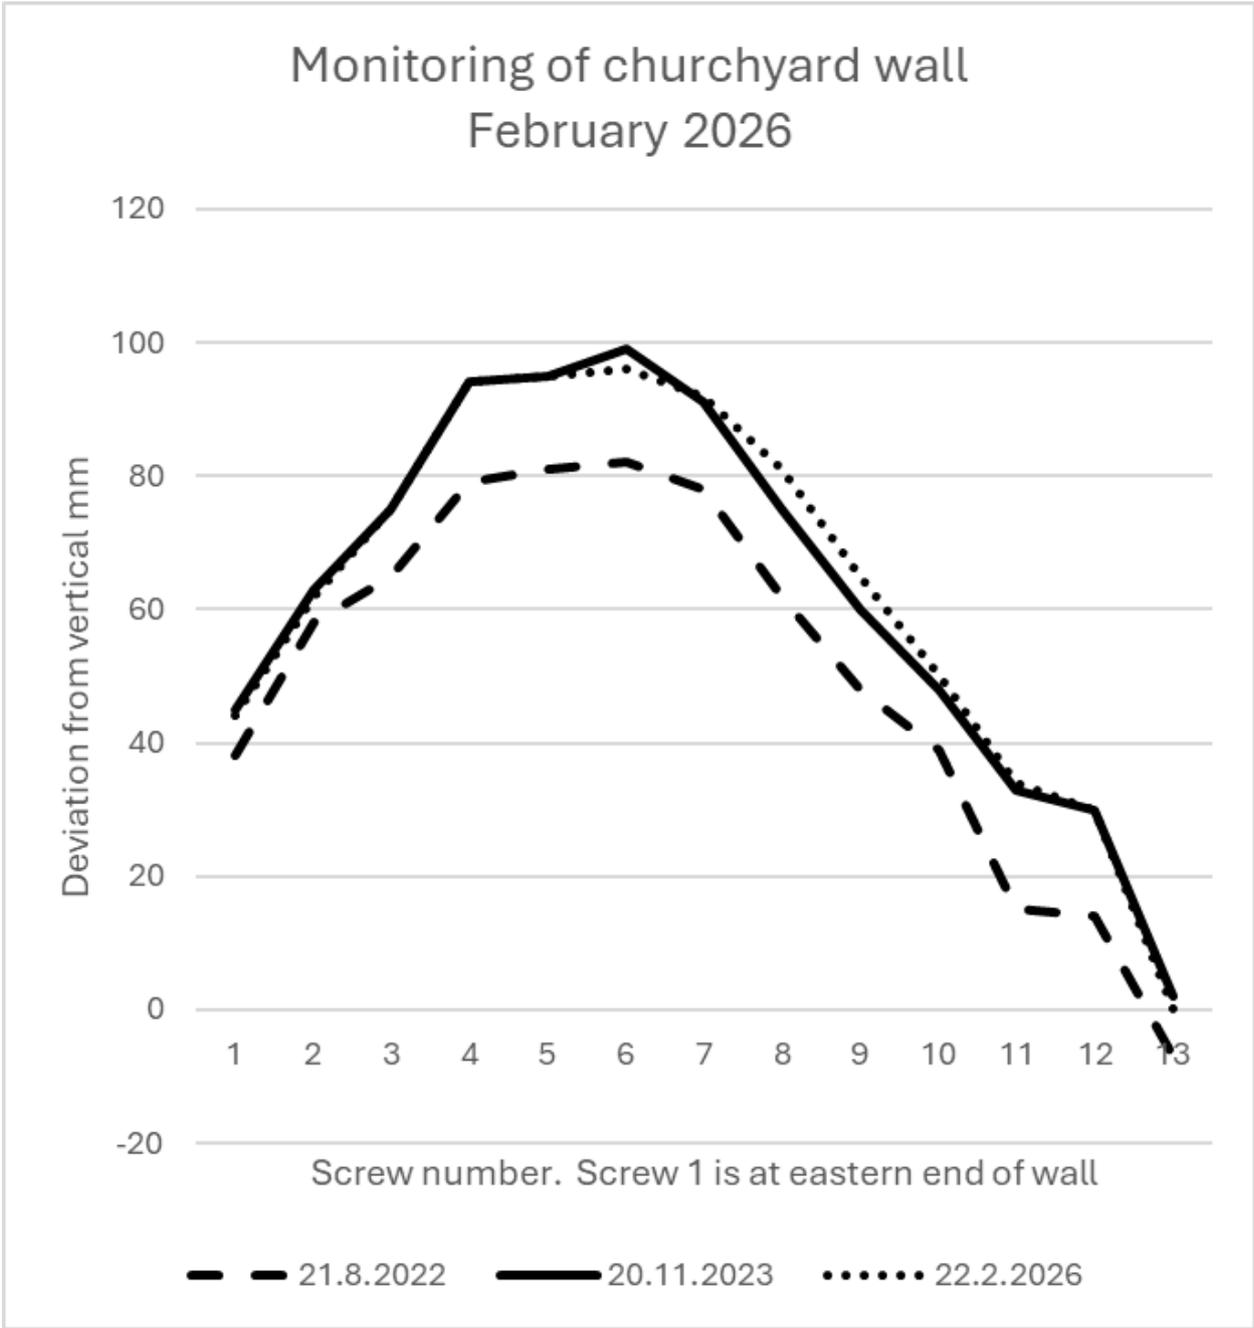

Additional measurements

Screw number	22.2.2025	20.8.2025	19.11.2025	22.2.2026
1	44	40	44	44
2	64	52	64	62
3	76	64	75	75
4	97	87	94	94
5	97	87	97	95
6	96	79	96	96
7	94	79	99	92
8	72	68	77	81
9	66	52	62	65
10	46	37	45	50
11	33	18	29	34
12	29	16	25	30
13	2	-13	-3	0

Deflection of screw number 6

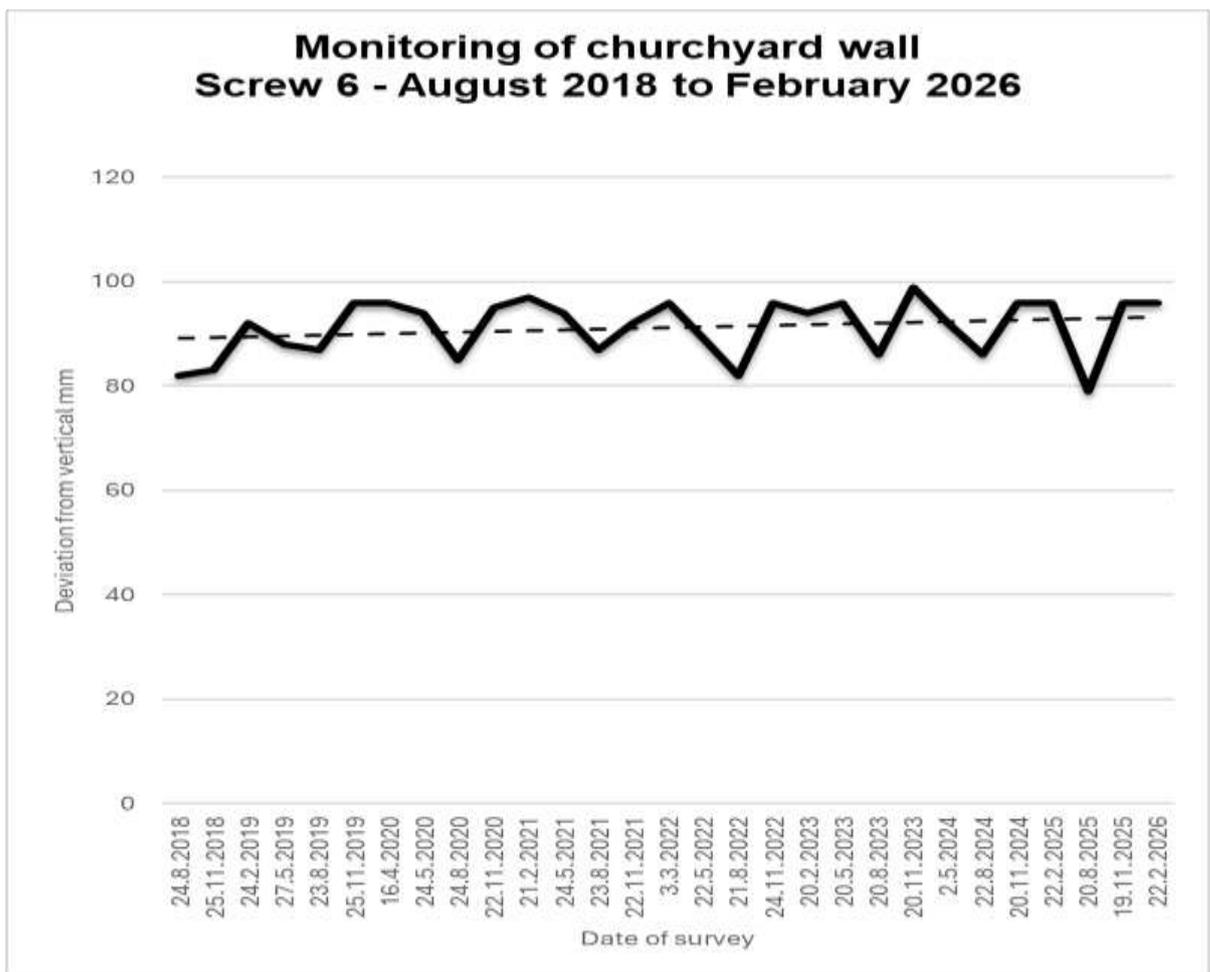

See Report 2025-03 for details. The chart above is an update of that in Report 2025-03.

C J Peat Parish Clerk 23 February 2026